


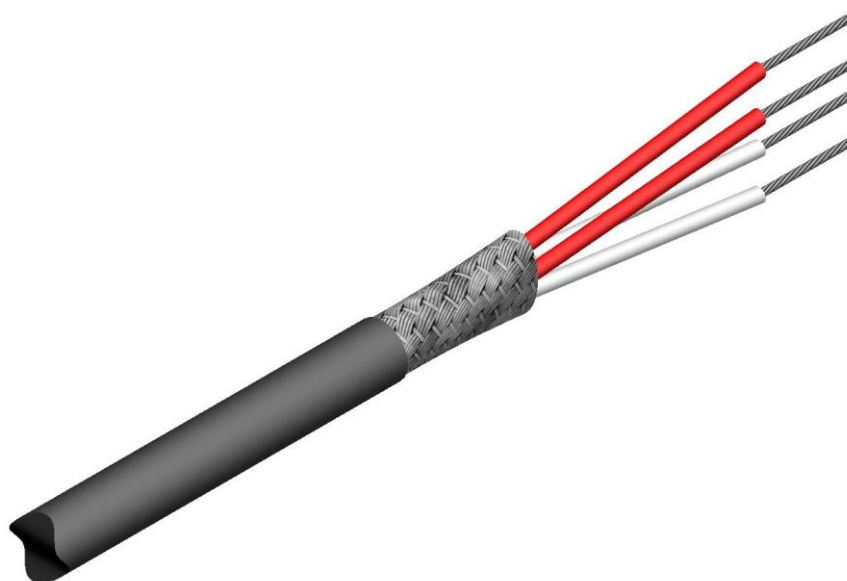

Cable for Pt100-sensors FEP/PFA-insulated

Model TEXSTEX

Example of use

Signal connection of Pt100-sensors.

Article number

Article no	Conduc-tors	Conductor area, mm ²	Conductor strands, mm	Sheathing diameter, mm	Weight, kg/km	Resistance, ohm/m	Colour code
12-00400	4	0.22	7 x 0.2	3.3	26	0.13	Red, red, white, white
12-00410	4	0.055	7 x 0.1	2.5	16	1.0	Red, red, white, white

Article no	Insulation	Screen	Min.Temp. °C	Max.Temp. °C
12-00400	FEP	Tinned copper	-100	200
12-00410	PFA	Nickelplated copper	-75	250